

Anti-IR Reflection IR Camera

Example 1

Cause

Scratches or foreign matters inside or outside the bubble





<Dusty and greasy bubble>

Solution

- Change the big scratched bubble with the new one.
- Remove the dust, dirt, stains, and spots.
- Use an air blower, a compressed air, or micro fabric to remove the dust and dirt.









Avoid touching the dome during the installation and try to keep the protective film on the camera unit the very end.

Example 2

Cause

When the position of the IR LED is inside the top cover





<The screen when the position of the IR IED is inside the top cover>

Solution

- Be careful of the tilt angle so that the IR LED should not enter the inside of the top cover.
- Install carefully for the IR LED not to enter the inside of the top cover due to the rotate angle.





Example 3

Cause

- Eva Cushion and the set assembly issues
- If the circular shape is distorted by incorrect assembly of the Eva Cushion.
- Top cover fastening is incomplete.





Solution

- Make sure that Eva Cushion is firmly pressed against the bubble.
- $\bullet \quad \text{Make sure that the plastic top cover and the bottom cover are fully tightened}.$
- Make sure that the vandal top cover and the safety screw are fully tightened.

Example 4

Cause

If the IR light is reflected by the column or wall in the direction in which the camera is installed and enters the lens.







<Nighttime>

Solution

- Avoid direct reflections from nearby objects about 20~30cm(7.87"~11.8") away.
- If there is a wall or pillar near the camera, adjust the angle.



IDIS Co., Ltd.

For more information, please visit at www.idisqlobal.com